

DTIC FILE COPY

4

AD-A194 470

NSWC TR 06-390

# **SAFETY EVALUATION OF THE EXPENDABLE SOUND VELOCITY PROBE (SSXSV)**

BY J. W. BAKER J. A. BARNES R. F. BIS P. B. DAVIS L. A. KOWALCHIK  
RESEARCH AND TECHNOLOGY DEPARTMENT

AUGUST 1986

DTIC  
ELECTE  
JUN 22 1988  
S D

Approved for public release; distribution is unlimited.




**NAVAL SURFACE WEAPONS CENTER**

Dahlgren, Virginia 22448-5000 • Silver Spring, Maryland 20903-5000

## REPORT DOCUMENTATION PAGE


1a. REPORT SECURITY CLASSIFICATION UNCLASSIFIED			1b. RESTRICTIVE MARKINGS		
2a. SECURITY CLASSIFICATION AUTHORITY			3. DISTRIBUTION/AVAILABILITY OF REPORT Approved for public release; distribution is unlimited		
2b. DECLASSIFICATION/DOWNGRADING SCHEDULE					
4. PERFORMING ORGANIZATION REPORT NUMBER(S) NSWC TR 86-390			5. MONITORING ORGANIZATION REPORT NUMBER(S)		
6a. NAME OF PERFORMING ORGANIZATION Naval Surface Weapons Center		6b. OFFICE SYMBOL (If applicable) R33		7a. NAME OF MONITORING ORGANIZATION	
6c. ADDRESS (City, State, and ZIP Code) 10901 New Hampshire Ave. Silver Spring, MD 20903-5000			7b. ADDRESS (City, State, and ZIP Code)		
8a. NAME OF FUNDING/SPONSORING ORGANIZATION		8b. OFFICE SYMBOL (If applicable)		9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER	
8c. ADDRESS (City, State, and ZIP Code)			10. SOURCE OF FUNDING NUMBERS		
			PROGRAM ELEMENT NO. NIE	PROJECT NO. 6R33KB	WORK UNIT ACCESSION NO. R7
11. TITLE (Include Security Classification) Safety Evaluation of the Expendable Sound Velocity Probe (SSXSV)					
12. PERSONAL AUTHOR(S) Baker, J. W.; Barnes, J. A.; Bis, R. F.; Davis, P. B.; Kowalchik, L. A.					
13a. TYPE OF REPORT		13b. TIME COVERED FROM TO		14. DATE OF REPORT (Year, Month, Day) 1986 August	
				15. PAGE COUNT 27	
16. SUPPLEMENTARY NOTATION					
17. COSATI CODES			18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number)		
FIELD	GROUP	SUB-GROUP			
10	03		Lithium PX28L Battery Safety Duracell DL <sub>1</sub> <sub>3</sub> N Manganese Dioxide		
19. ABSTRACT (Continue on reverse if necessary and identify by block number)					
<p>→ The Arctic Submarine Laboratory, Naval Ocean Systems Center, San Diego, sought approval to carry the Expendable Sound Velocity Probe (SSXSV) on board submarines. The battery used by the SSXSV employs a lithium/manganese dioxide couple. The battery is assembled by the SSXSV supplier - Sippican Ocean Systems, Inc. - from a Duracell PX28L battery and a DL<sub>1</sub><sub>3</sub>N cell. The Naval Surface Weapons Center, White Oak, conducted a safety evaluation of the SSXSV as required by NAVSEA Notice 9310. This report presents the results of the safety evaluation of the SSXSV.</p> <p style="text-align: right;">DL 1/3N</p>					
20. DISTRIBUTION/AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input type="checkbox"/> SAME AS RPT. <input type="checkbox"/> DTIC USERS			21. ABSTRACT SECURITY CLASSIFICATION UNCLASSIFIED		
22a. NAME OF RESPONSIBLE INDIVIDUAL J. W. BAKER			22b. TELEPHONE (Include Area Code) (202) 394-2310		22c. OFFICE SYMBOL R33

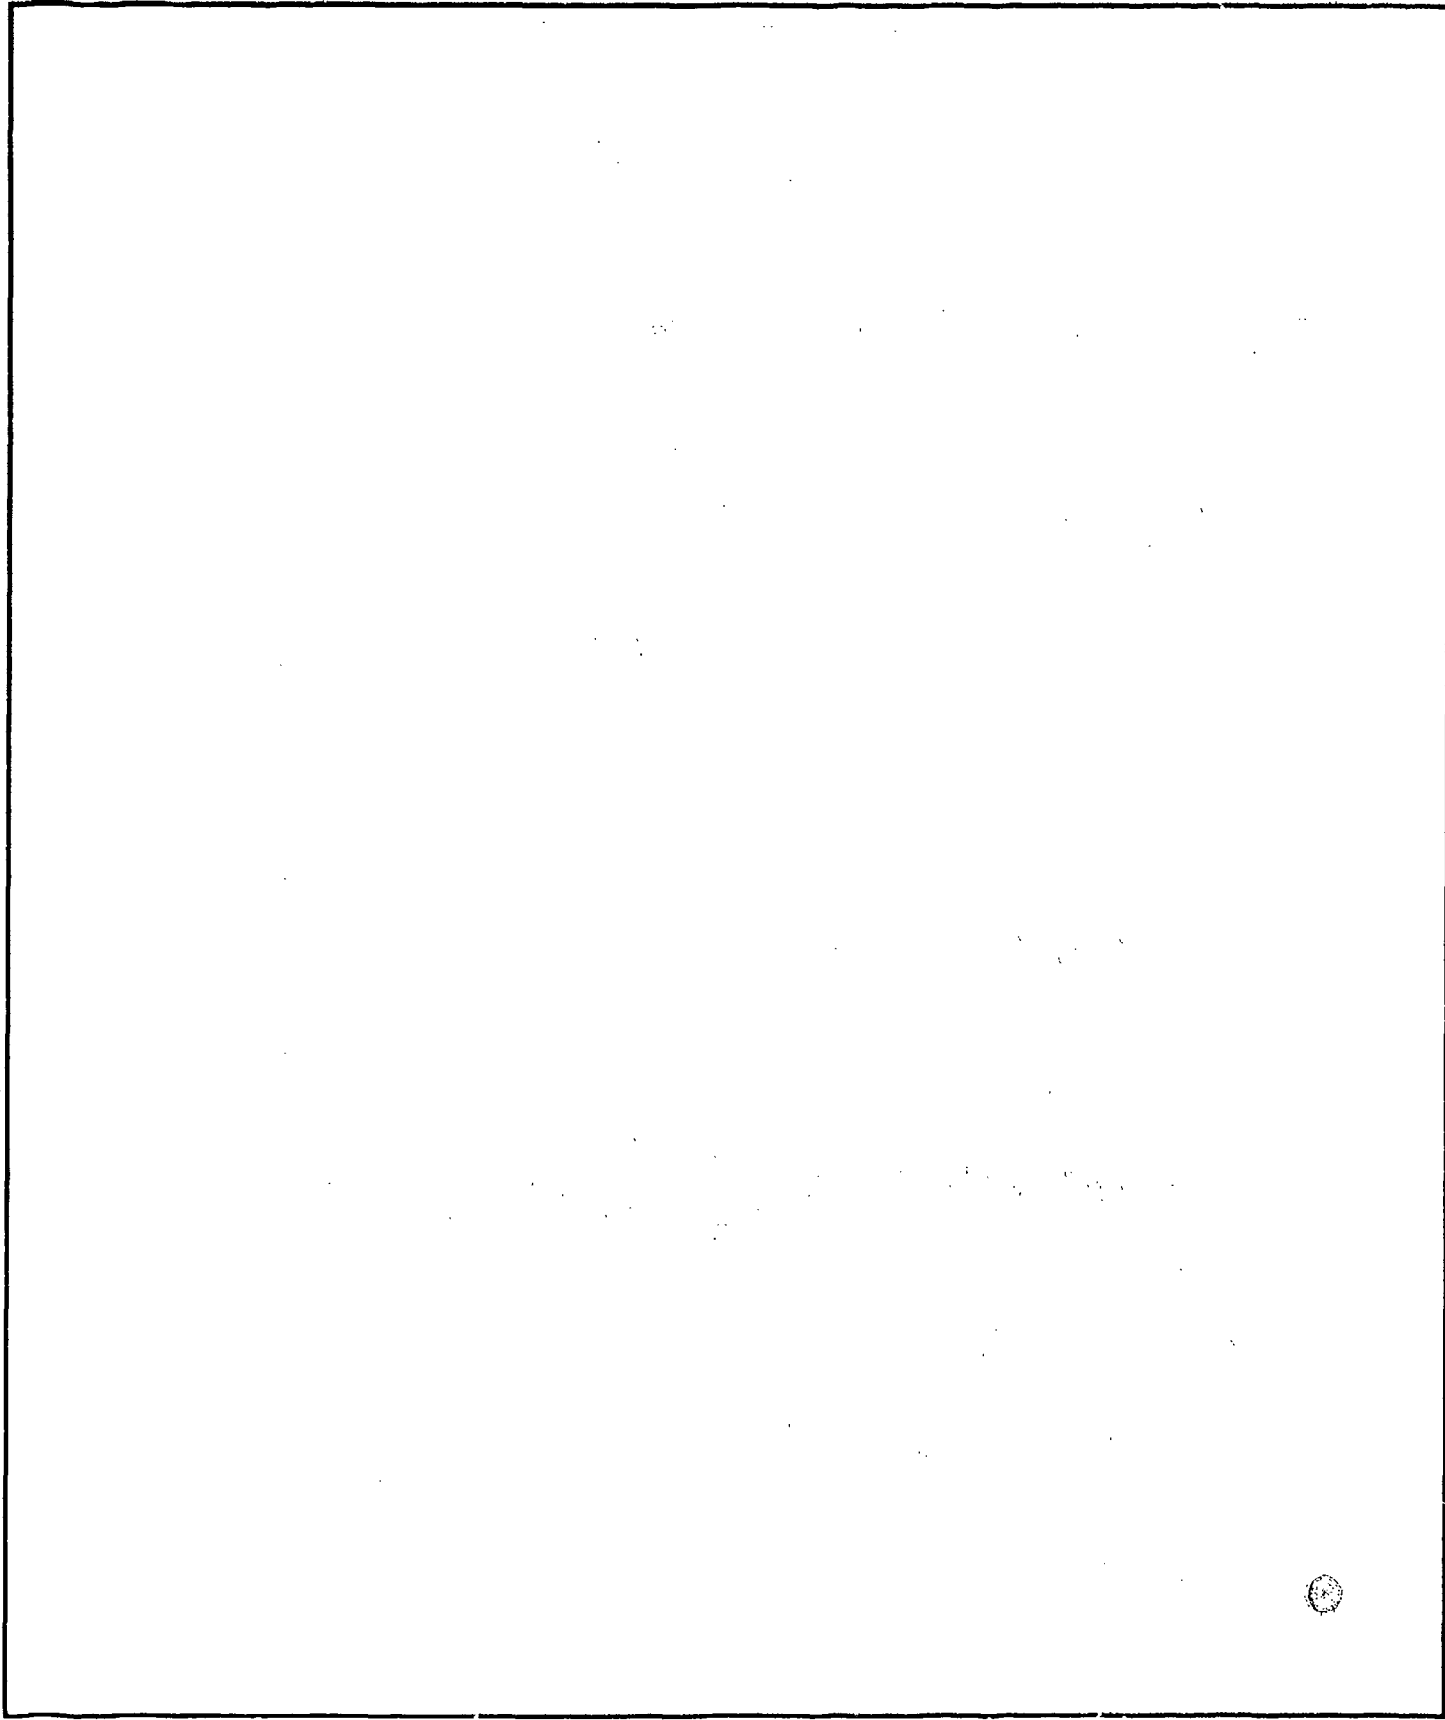

FOREWORD

This work presents the results of the safety evaluation performed on the Expendable Sound Velocity Probe. The evaluation was initiated by the Arctic Submarine Laboratory, Naval Ocean Systems Center, San Diego. The purpose of the evaluation was to obtain approval for internal carriage of the probe unit on board submarines. The safety evaluation performed on the system was conducted in accordance with NAVSEA Notice 9310 by the Naval Surface Weapons Center, White Oak.

Approved by:

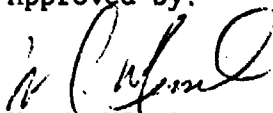

W. T. MESSICK, Acting Head  
Materials Division

## CONTENTS

<u>Chapter</u>		<u>Page</u>
1	INTRODUCTION. . . . .	1
2	EXPERIMENTAL. . . . .	3
	BATTERY TESTING . . . . .	3
	SSXSV SYSTEM TESTING. . . . .	4
3	RESULTS AND DISCUSSION. . . . .	7
	BATTERY TESTING . . . . .	7
	SSXSV SYSTEM TESTING. . . . .	12
4	CONCLUSIONS . . . . .	17
	DISTRIBUTION. . . . .	(1)



Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Dist.	Avail and/or Special
A-1	

## ILLUSTRATIONS

<u>Figure</u>		<u>Page</u>
1	SSXSV PROBE/CANISTER CONFIGURATION. . . . .	2
2	SSXSV PROBE THERMOCOUPLE PLACEMENT. . . . .	5
3	SHORT CIRCUIT OF AN SSXSV BATTERY NOT POTTED IN A PROBE . . . . .	7
4	CONSTANT CURRENT DISCHARGE AND REVERSAL OF AN SSXSV BATTERY NOT POTTED IN A PROBE . . . . .	8
5	RESULTS OF HEATING A PX28L BATTERY. . . . .	9
6	10mA DISCHARGE OF AN SSXSV BATTERY (NOT POTTED IN A PROBE) TO 50% OF THE ORIGINAL CAPACITY . . . . .	10
7	100mA CHARGE OF A 50% DISCHARGED SSXSV BATTERY NOT POTTED IN A PROBE . . . . .	10
8	DAY 1 OF A 10mA DISCHARGE OF AN SSXSV BATTERY (NOT POTTED IN A PROBE) TO 80% CAPACITY REMOVAL. . . . .	11
9	DAY 2 OF A 10mA DISCHARGE OF AN SSXSV BATTERY (NOT POTTED IN A PROBE) TO 80% CAPACITY REMOVAL. . . . .	12
10	CHARGING DATA FOR ONE 80% PREVIOUSLY DISCHARGED SSXSV BATTERY NOT POTTED IN A PROBE . . . . .	12
11	NORMAL CHARGING DATA OF AN 80% PREVIOUSLY DISCHARGED SSXSV BATTERY (NOT POTTED IN A PROBE) . . . . .	13
12	DATA FOR THE FIRST 96 MINUTES OF CHARGING A FRESH SSXSV BATTERY NOT POTTED IN A PROBE . . . . .	13
13	SHORT CIRCUIT DATA FOR AN SSXSV BATTERY POTTED IN A PROBE . . . . .	14
14	CONSTANT CURRENT DISCHARGE AND REVERSAL OF AN SSXSV BATTERY (POTTED IN THE PROBE) AT THE C/2 RATE . . . . .	15
15	RESULTS OF DISCHARGING AN SSXSV BATTERY (POTTED IN PROBE 7) AT THE C/2 RATE INTO VOLTAGE REVERSAL. . . . .	16

## TABLES



<u>Table</u>		<u>Page</u>
1	ANALYSIS OF THE OFF-GAS PRODUCTS OF TWO Li/MnO <sub>2</sub> BATTERIES . . . . .	16

## CHAPTER 1

## INTRODUCTION

The Expendable Sound Velocity Probe (SSXSV) is manufactured by Sippican Ocean Systems, Inc. The SSXSV battery is manufactured by Duracell International, Inc.

The SSXSV probe pictured in Figure 1 consists of a small probe and a monitoring lead spool (for transmitting sound data to the submarine), encased in a metal launch canister. The canister is 98cm in length and 7.5cm in diameter. The portion of the canister which contains the probe and battery is sealed, isolating the probe and battery from the outside atmosphere. The battery being used employs a lithium/manganese dioxide ( $\text{Li/MnO}_2$ ) couple, comprised of three 3-volt (V) cells. The single cells are Duracell DL<sub>3</sub>N cells. The anode, cathode, and total cell reactions are given by equations 1, 2, and 3, respectively. Two of the DL<sub>3</sub>N cells



are connected in series and encased in a metal can by Duracell to make a commercially available PX28L battery. The third cell is then connected in series with the PX28L by Sippican to give a nominal battery voltage of 9V. The capacity (C) for this battery is rated by the manufacturer at 160 milliampere-hours (mAh) at a rate of C/30.

The safety evaluation was performed by the Naval Surface Weapons Center, White Oak (NSWC/WC), on the SSXSV system containing the Duracell battery. Preliminary experiments were also run on the battery alone. The evaluation was conducted in accordance with procedures outlined by NAVSEA Notice 9310.

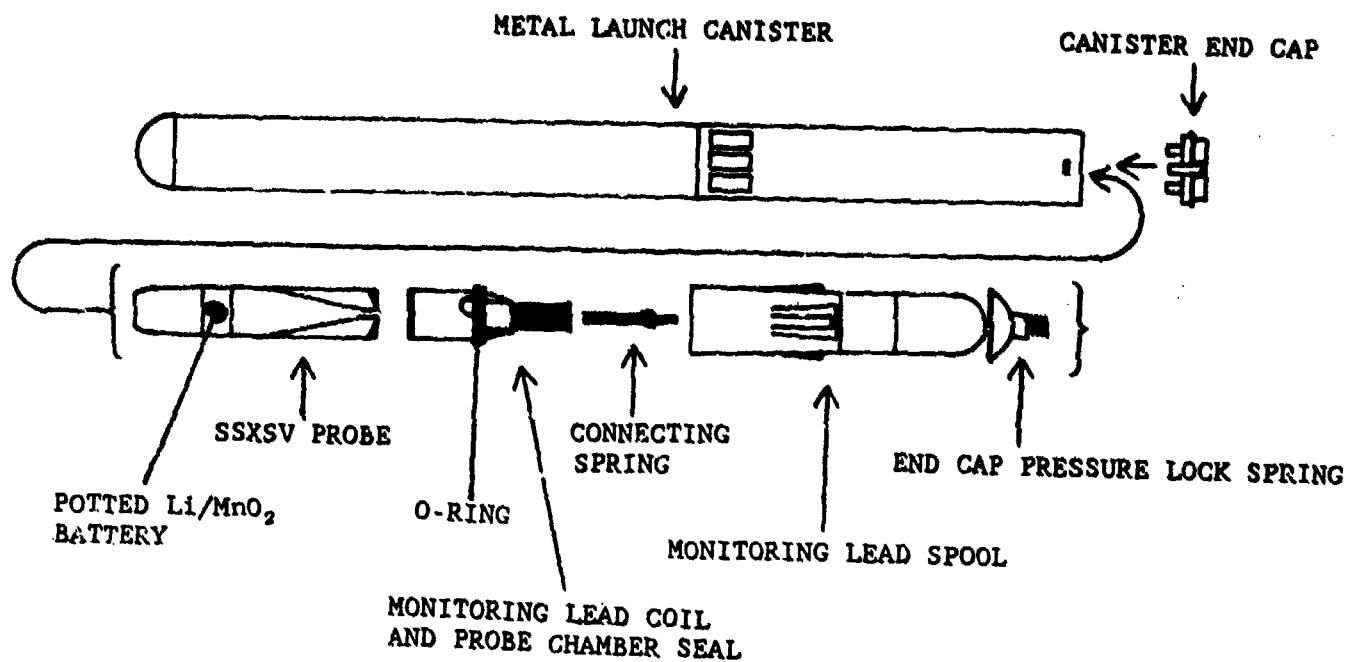


FIGURE 1. SSXSV PROBE/CANISTER CONFIGURATION



## CHAPTER 2

## EXPERIMENTAL

DL<sub>1/3</sub>N cells and PX28L batteries were obtained by NSWC from Duracell International, Inc., for testing. The lot of DL<sub>1/3</sub>N cells studied was labeled 500084-1 and the lot of PX28L batteries was labeled 500085-1. Seven SSXSV probes (lot label UISSXSV 300648-1), sent to NSWC by Sippican for testing, were sequentially numbered from 13973 to 13979. Eighteen batteries, independent of probe units, and seven batteries potted in probe units were tested. Six SSXSV batteries were shorted; six SSXSV batteries were discharged at a constant current and forced into voltage reversal; two PX28L batteries were heated; three SSXSV batteries were discharged, followed by charging; and one fresh SSXSV battery was charged. Batteries in three of the SSXSV probes were shorted and batteries in four of the probes were discharged at a constant current and forced into voltage reversal.

## BATTERY TESTING

All batteries except those which were heated to high temperatures, were wrapped with glass tape and FIBERFRAX insulation to simulate the heat retention in the SSXSV system.

Short Circuit Testing

One DL<sub>1/3</sub>N Li/MnO<sub>2</sub> cell was connected in series with one PX28L Li/MnO<sub>2</sub> battery (two DL<sub>1/3</sub>N cells connected in series and encased in a metal can) to produce a 9V SSXSV battery. Six of these batteries were prepared by the staff of NSWC/WO and then shorted through less than .02 ohm ( $\Omega$ ). The battery current and voltage were monitored and the temperatures of the PX28L can (thermocouple no. 1) and the DL<sub>1/3</sub>N can (thermocouple no. 2) were also monitored. Five of the batteries were shorted for approximately two hours and one battery was shorted for 16 hours.

Constant Current Discharge and Reversal Testing

Six three-cell batteries, prepared as before, were discharged through 112 $\Omega$  at the C/2 rate (80mA rate). When the voltage dropped to 0 volt, the battery was driven 150 percent into voltage reversal using an external power supply with current limited to 100 mA and voltage limited to 20V. The voltage and current of the batteries were monitored along with the can temperatures of the PX28L (thermocouple no. 1) and the DL<sub>1/3</sub>N (thermocouple no. 2).

High Temperature Testing

Two PX28L batteries were wrapped with THERMOLYNE BRISKHEAT flexible electric heating tape. These batteries were then heated (at a rate of 20°C/minute) until the heating tape failed. The voltage and can temperature of the batteries were monitored.

Charging Discharged Batteries

Three SSXSV batteries were discharged and then charged. One of the three SSXSV batteries was discharged 50 percent of the advertised capacity through a 900Ω resistor at the 10mA rate. The battery was then charged (after incubating overnight) at the 100mA rate - voltage being limited to 20V - to 100 percent of the theoretical capacity. Two of the three SSXSV batteries were discharged 80 percent of the manufacturer's rated capacity through a 900Ω resistor at the 10mA rate. After incubating overnight, the batteries were charged at the 100mA rate to 100 percent of the theoretical capacity. The voltage, current, and can temperatures of the PX28L (thermocouple no. 1) and DL<sub>3</sub>N (thermocouple no. 2) were monitored.

Charging a Fresh Battery

One fresh SSXSV battery was charged at the 100mA rate for approximately four hours. The voltage, current, and can temperatures of the PX28L (thermocouple no. 1) and DL<sub>3</sub>N (thermocouple no. 2) were monitored.

SSXSV SYSTEM TESTING

All SSXSV batteries are potted inside a probe using a low stress epoxy encapsulation product (product no. SY6024) manufactured by Anchor Seal Epoxy Products.

Short Circuit Testing

Three batteries were shorted through less than .02Ω inside SSXSV probes. The voltage, current, and two thermocouples were monitored on each probe. For the first battery, a thermocouple was placed on the canister and a thermocouple was placed just inside the canister (where the voltage leads protruded through a plastic sealing cap). For the next two batteries tested, the placement of the thermocouples was changed. The probes were removed from the canisters and one thermocouple was placed just over the battery on the battery potting - the location of the battery was found using a magnet. The second thermocouple was placed in the nose hole of the probe. Figure 2 shows the placement of the thermocouples on the probe.

Constant Current Discharge and Reversal Testing

The batteries in the remaining four probes were discharged at the C/2 rate (80mA rate) through 112Ω and forced into voltage reversal with a power supply.

The first battery was discharged and forced into voltage reversal with the probe being outside the canister so the thermocouples could be easily positioned. The battery potting was found to be cracked when the probe was removed from the canister. Although this condition existed, the nominal voltage of the battery was normal (9.8V), and the test was conducted. The second probe battery was discharged and forced into voltage reversal in the same manner as the first but the potting was not cracked prior to testing. In order to trap venting gases and test the durability of the canister, the last two probes were discharged and forced into voltage reversal inside the canister. Holes were drilled and tapped in two canisters for a  $\frac{1}{8}$ -inch NPT pipe fitting. An evacuated stainless steel vessel was connected to this fitting to collect venting products. Thermocouples were placed on the outside of the canister and monitored along with voltage and current.

All voltage, current, and temperature readings were monitored and stored using an IBM PC/XT and a KEITHLEY data acquisition system. Some important events were also recorded on videotapes which are on file at NSWC/WO.

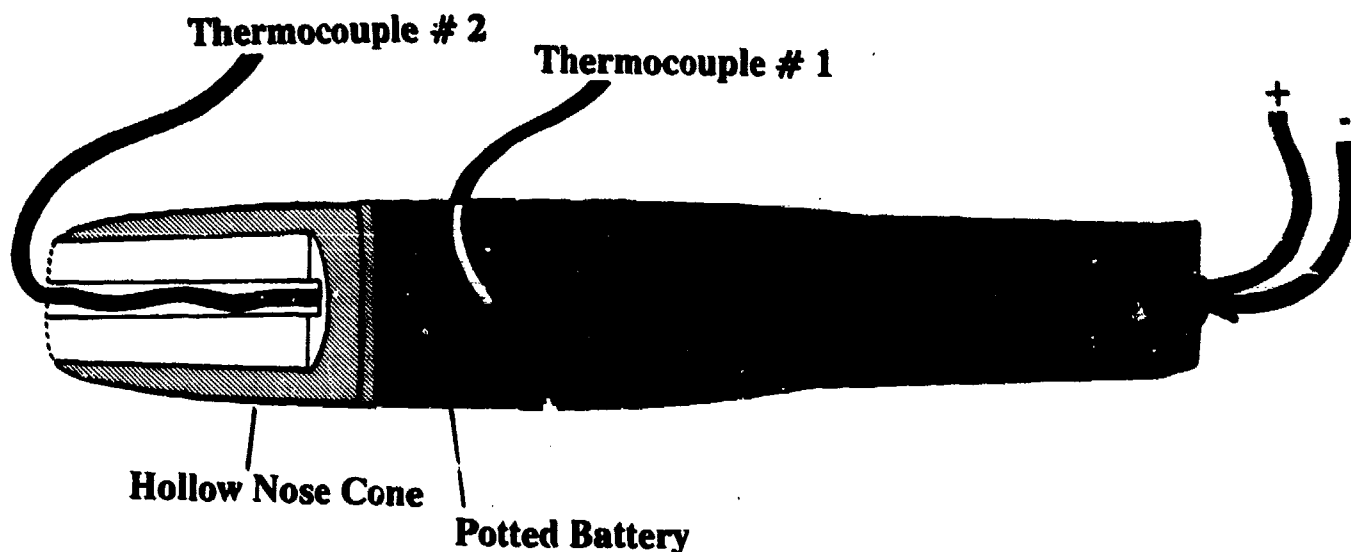


FIGURE 2. SSXSV PROBE THERMOCOUPLE PLACEMENT

## CHAPTER 3

## RESULTS AND DISCUSSION

## BATTERY TESTING

Short Circuit Testing

Six SSXSV batteries (one DL<sub>3</sub>N cell in series with one PX28L battery) were shorted. In less than five minutes voltage readings fell from 9.8 volt to 0 volt. Figure 3 is a representative graph of the short circuit tests. Note that within 30 minutes the temperature measured on the PX28L battery rose to a peak. On the average the peak temperature was 92°C. This temperature fell to ambient over a time period of about eight hours. The temperature measured on the single DL<sub>3</sub>N cell, however, remained ambient throughout the test. The SSXSV battery did not explode, vent, leak electrolyte, or show any signs of disfiguration due to shorting.

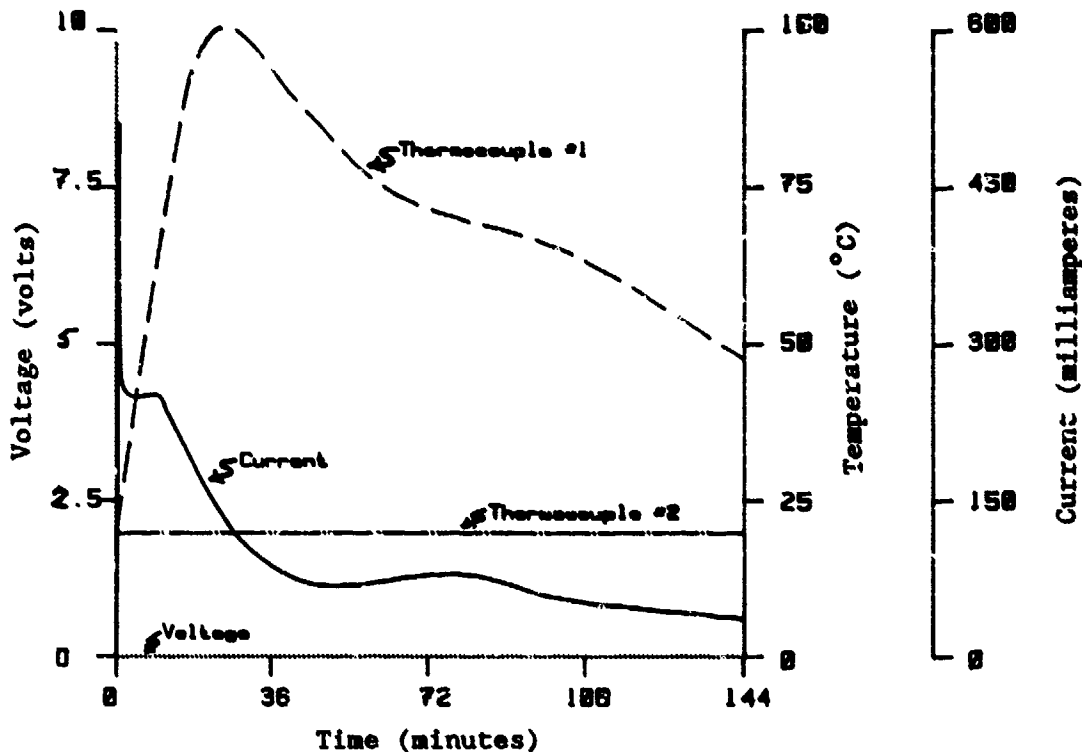


FIGURE 3. SHORT CIRCUIT OF AN SSXSV BATTERY NOT POTTED IN A PROBE

### Constant Current Discharge and Reversal Testing

Six SSXSV batteries were discharged at a constant current and forced into voltage reversal with a power supply. The batteries were discharged at the 80mA rate to 0 volt and then additionally driven 150 percent into voltage reversal at the same current. The voltage continued to drop and by the end of the test reached approximately -10V. During the first 75 minutes of the test, the voltage dropped markedly (on the order of 10V) and then leveled off for 65 minutes. During the last portion of the test, the voltage again dropped. During this period the current also dropped (Figure 4). The average maximum temperature recorded on a forced overdischarge was 57°C. This maximum temperature was again recorded on the PX28L and the DL<sub>3</sub>N cell can temperature remained ambient. Like the batteries that were shorted, the batteries discharged into reversal did not explode, vent, leak electrolyte, or show any signs of disfiguration.

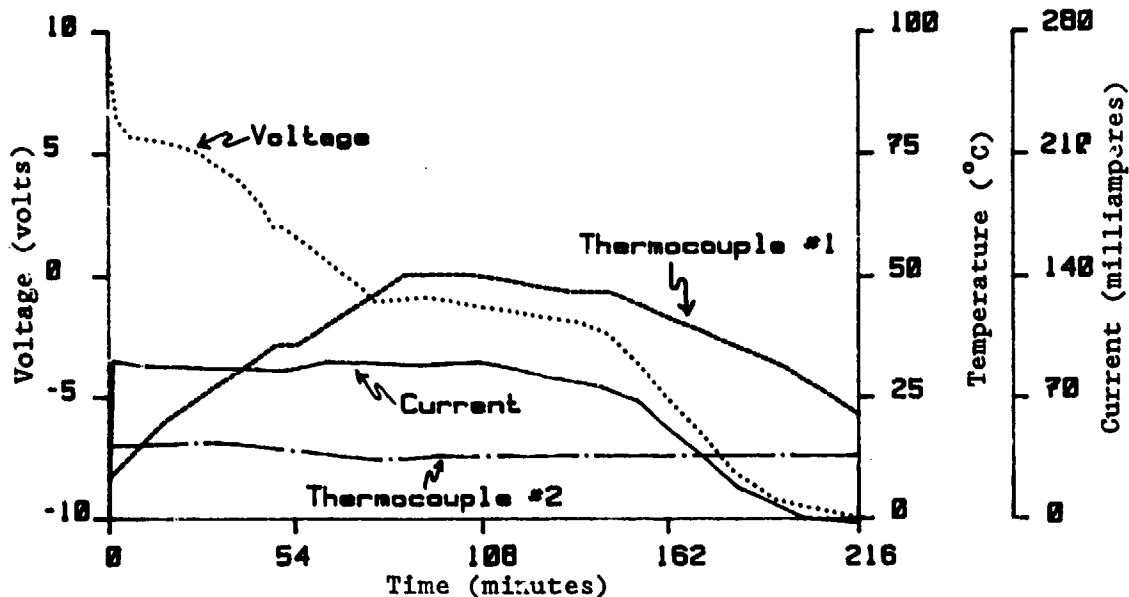


FIGURE 4. CONSTANT CURRENT DISCHARGE AND REVERSAL OF AN SSXSV BATTERY NOT POTTED IN A PROBE

### High Temperature Testing

Two PX28L batteries were heated; at temperatures above 200°C, the negative ends of the batteries vented and severed the heat tape. A few minutes prior to the batteries venting, the open circuit voltage (OCV) faltered and began to drop. Figure 5 is a representative graph of a high temperature test conducted on a PX28L battery. The maximum temperatures recorded were 350°C and 435°C at the moment when failure occurred. Each cell in the battery failed at approximately the same time (differing by less than five seconds). The first cell failure occurred when the temperature maximum occurred. There was a small amount of burning (flames lasting less than ten seconds) associated with the failure of each battery.

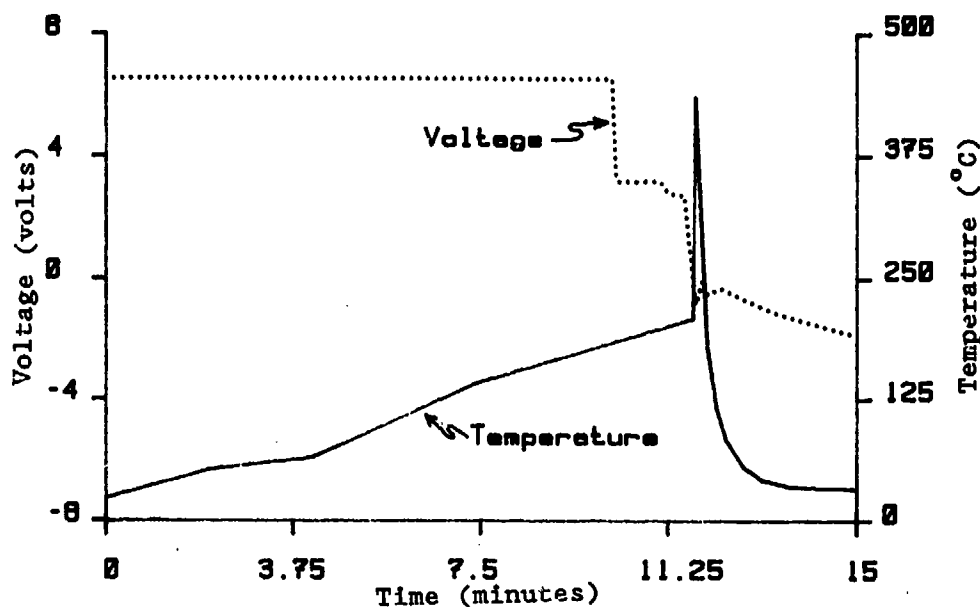


FIGURE 5. RESULTS OF HEATING A PX28L BATTERY

#### Charging Discharged Batteries

Three SSXSV batteries were discharged at the 10mA rate and then charged at the 100mA rate. The first battery was discharged 50 percent. During the discharge, the temperature on the PX28L and the DL<sub>3</sub>N rose less than 5°C. During charging, the temperature on the DL<sub>3</sub>N remained ambient but the temperature of the PX28L rose to 84°C. However, there was no explosion, venting, leakage of the electrolyte, or any signs of disfiguration. Figures 6 and 7 show the discharge and charging curves for this battery. The next battery was discharged at the 10mA rate to remove 80 percent of the capacity. The discharge took place over a period of two days and the temperatures measured on the PX28L and the DL<sub>3</sub>N remained ambient. Figures 8 and 9 show the discharge curves for day one and two, respectively. Following discharge, the battery was charged at a current of 100mA. Thirty minutes into the charge, the battery vented. Small flames were observed which lasted about five seconds. From the beginning of the test, the temperature on the PX28L increased but the DL<sub>3</sub>N temperature remained at ambient. It was the DL<sub>3</sub>N that had ruptured even though its temperature was the one that remained at ambient. The temperature on the PX28L peaked at 108°C. The flames associated with the rupture burned in the area where the thermocouple was located on the single cell. For this reason it was deduced that thermocouple no. 2 was not working properly, which gave false ambient readings on the DL<sub>3</sub>N cell. The current for this test started at 100mA as planned but unexpectedly increased to 220mA at the time of and just before the rupture. Figure 10 is a summary of this data. Another SSXSV battery was tested in the same manner to try and reproduce the results obtained in the previous charging. The results, however, were not the same; during charging the

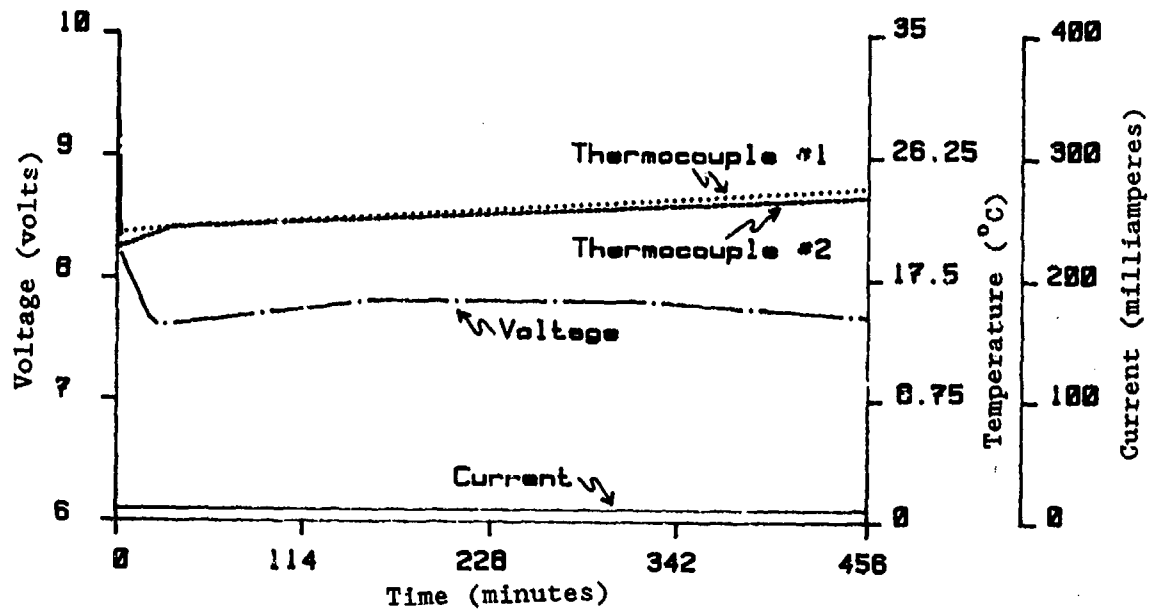


FIGURE 6. 10mA DISCHARGE OF AN SSXSV BATTERY (NOT POTTED IN A PROBE) TO 50% OF THE ORIGINAL CAPACITY

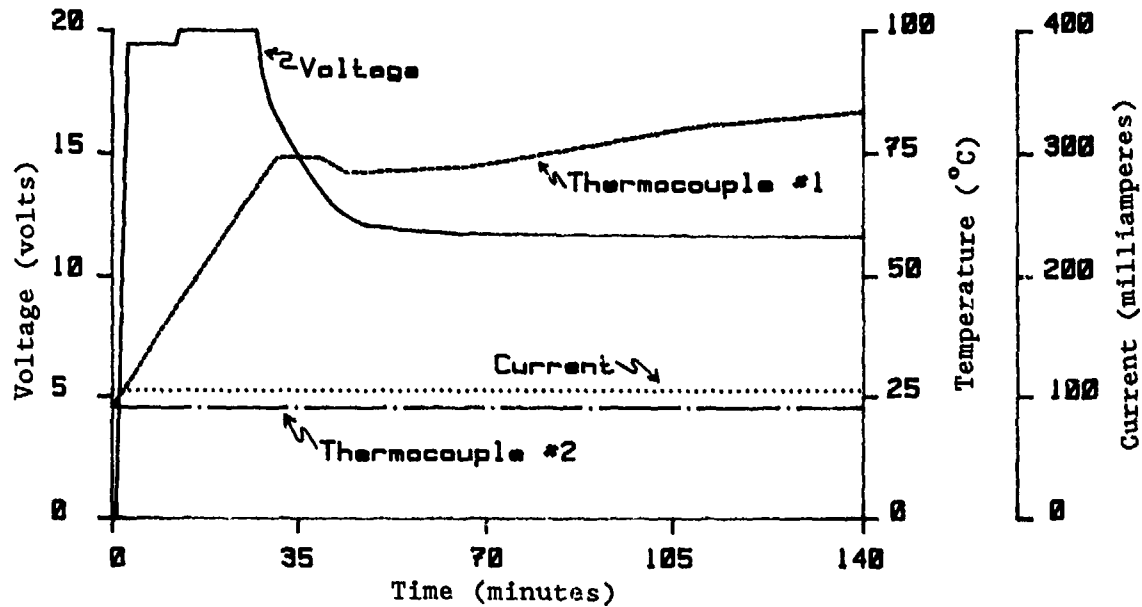


FIGURE 7. 100mA CHARGE OF A 50% DISCHARGED SSXSV BATTERY NOT POTTED IN A PROBE

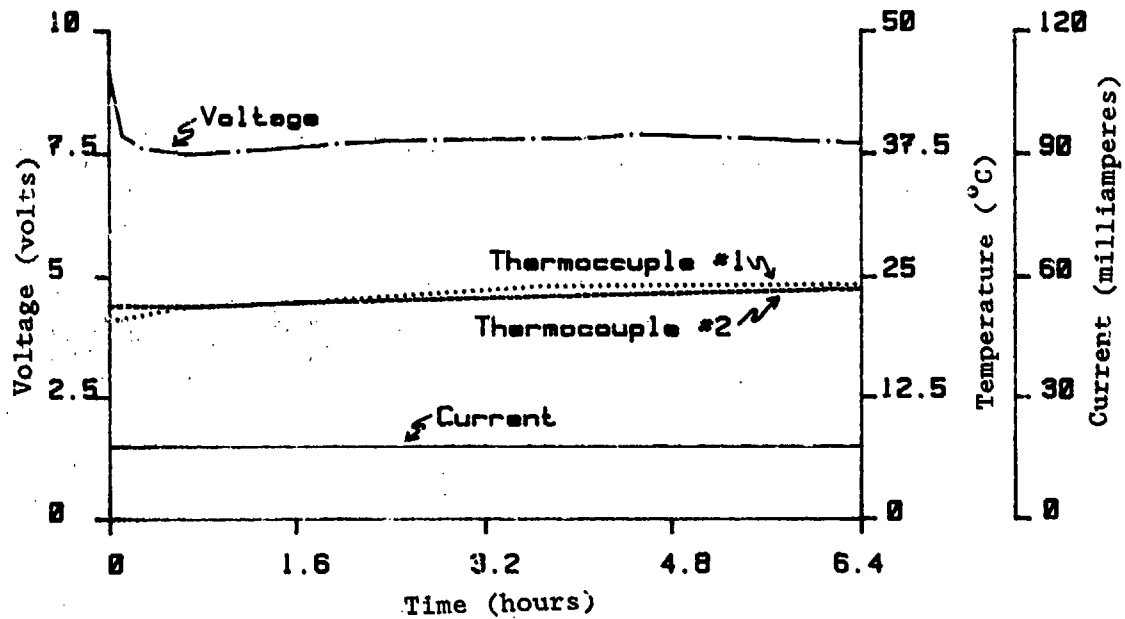


FIGURE 8. DAY 1 OF A 10mA DISCHARGE OF AN SSXSV BATTERY (NOT POTTED IN A PROBE) TO 80% CAPACITY REMOVAL

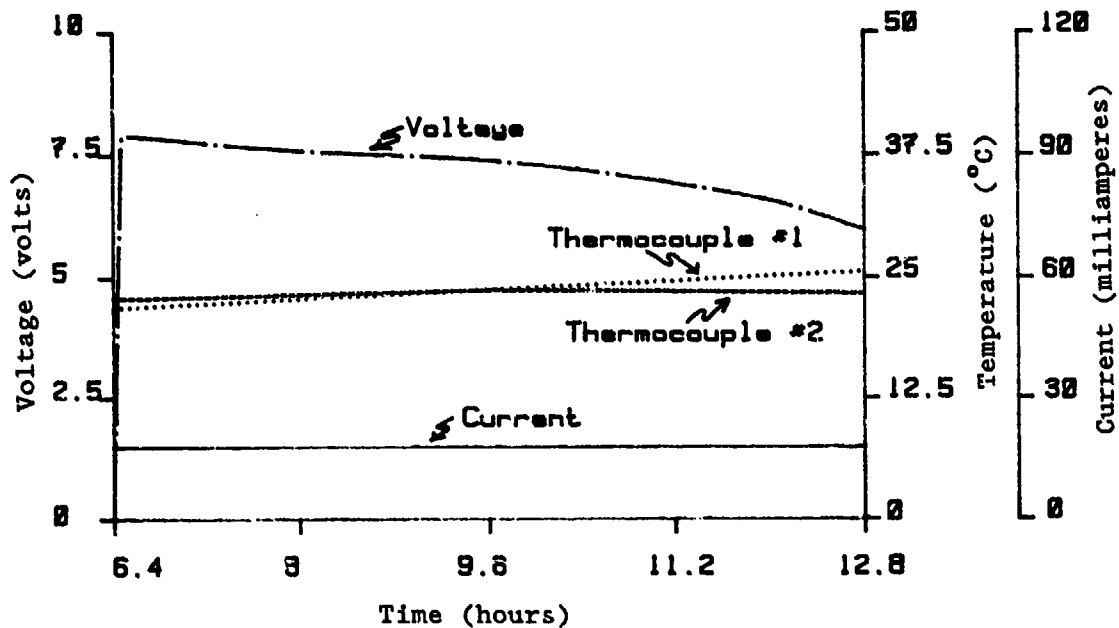


FIGURE 9. DAY 2 OF A 10mA DISCHARGE OF AN SSXSV BATTERY (NOT POTTED IN A PROBE) TO 80% CAPACITY REMOVAL



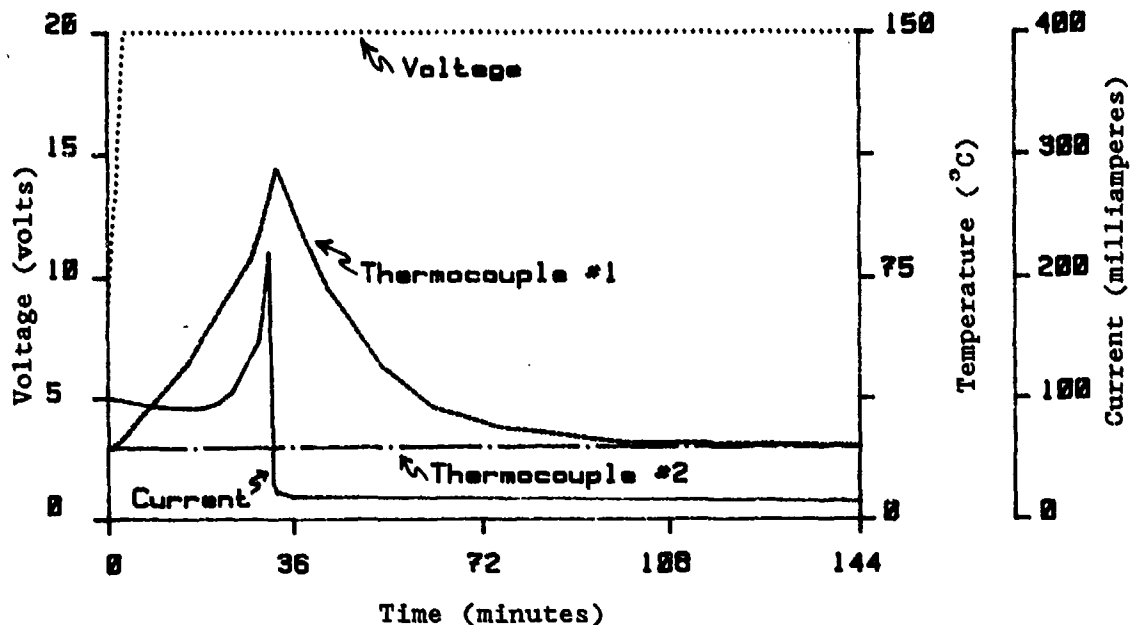


FIGURE 10. CHARGING DATA FOR ONE 80% PREVIOUSLY DISCHARGED SSXSV BATTERY NOT POTTED IN A PROBE

temperature of the PX28L rose to 82°C after 30 minutes and remained elevated. The temperature on the DL<sub>3</sub>N remained at ambient. After 30 minutes, the voltage dropped and the current remained relatively constant throughout the test. Figure 11 summarizes the charging data of this SSXSV battery.

#### Charging a Fresh Battery

One SSXSV battery was charged at the 100mA rate for four hours. All the pertinent data was recorded within the first 90 minutes of the test, and after 96 minutes the graphed data showed no change. Figure 12 shows the first 96 minutes of testing for this battery. The charging current was approximately 100mA initially. Forty minutes into the test, the power supply voltage automatically increased in response to a reduction in current caused by an apparent increase in battery impedance. The voltage reached the upper limit of the power supply at 20V. During this time, the temperature on the PX28L had peaked at 105°C. When the current had dropped to about 40mA the temperature began dropping. The DL<sub>3</sub>N temperature remained ambient and there was no explosion, venting, or leakage of electrolyte. However, both the PX28L and the DL<sub>3</sub>N showed signs of swelling.

#### SSXSV SYSTEM TESTING

##### Short Circuit Testing

Three SSXSV batteries, potted in three SSXSV probes, were shorted. Probe 1 (serial no. 13973) was shorted inside the SSXSV canister. The discharge curve

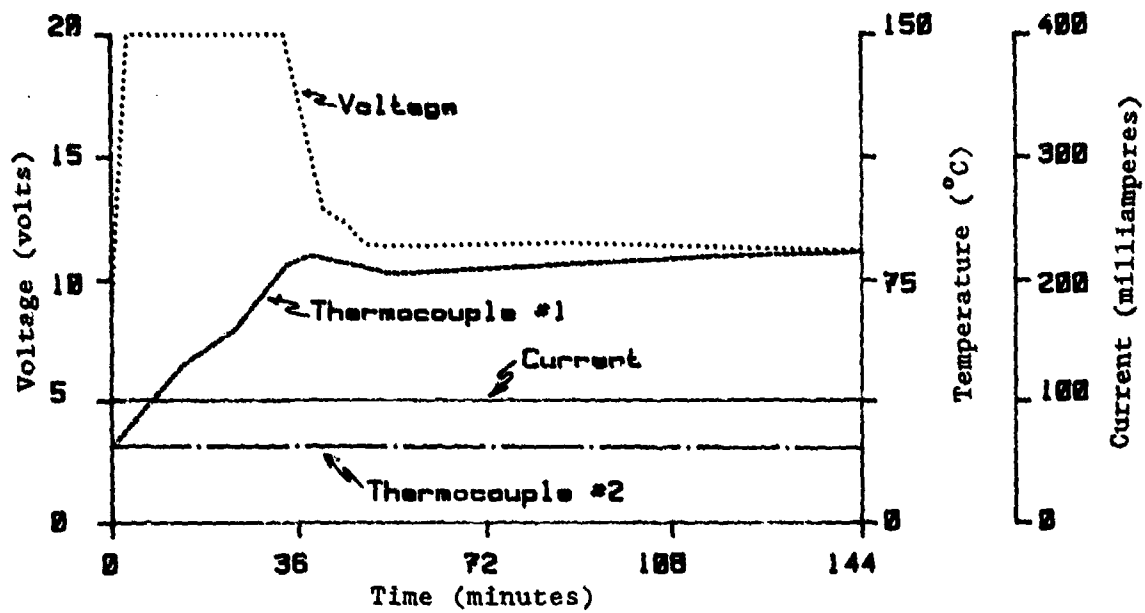


FIGURE 11. NORMAL CHARGING DATA OF AN 80% PREVIOUSLY DISCHARGED SSXSV BATTERY NOT POTTED IN A PROBE

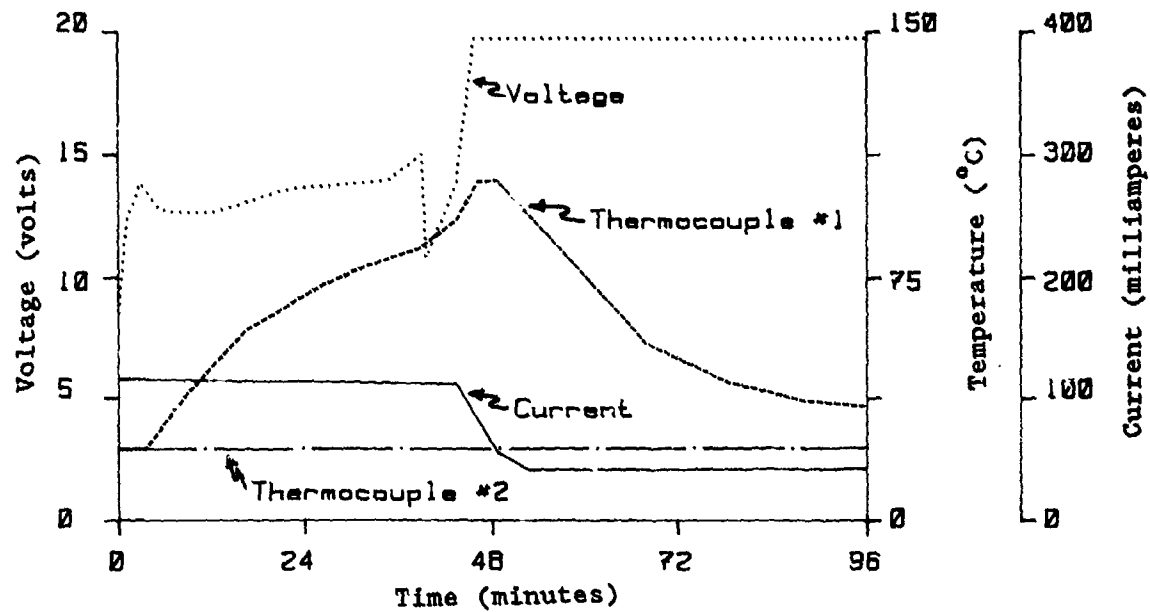


FIGURE 12. DATA FOR THE FIRST 96 MINUTES OF CHARGING A FRESH SSXSV BATTERY NOT POTTED IN A PROBE

resembled the discharge curves of the SSXSV batteries previously shorted. The temperatures monitored, however, were recorded as ambient. The thermocouples had been placed on the exterior of the canister; for the next two short circuit tests, the batteries (in probes) were tested outside the canister. Temperatures of the battery potting were monitored on the next two probes. The discharge curves for probe 2 (serial no. 13974) and probe 3 (serial no. 13975) were similar to the discharge curve for probe 1 in all respects except temperature. The average maximum temperature recorded on the potting of the two probes was 35°C, about 10°C above ambient. Figure 13 is a representative graph of shorting SSXSV batteries potted in probes. During these three tests, there were no ventings, explosions, leakage of electrolyte, or noticeable disfigurements associated with the probes. Dissection of the probes also disclosed that the batteries had not vented, exploded, leaked electrolyte, or become disfigured.

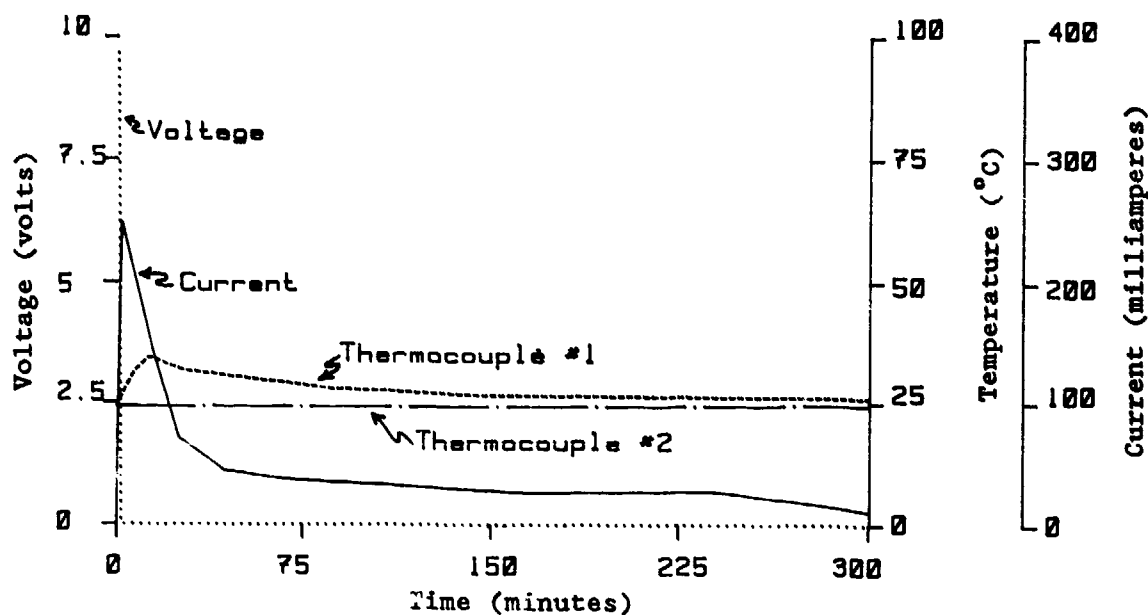


FIGURE 13. SHORT CIRCUIT DATA FOR AN SSXSV BATTERY POTTED IN A PROBE

#### Constant Current Discharge and Reversal Testing

Probe 4 (serial no. 13976), the first of four probes discharged into voltage reversal, had a crack in the battery potting prior to testing. The OCV of the battery was measured as 9.82V. Other OCV's for previous batteries tested were between 9V and 10V, so it was decided to proceed with the testing of this probe battery. No cause for the cracked potting was evident. The battery followed a normal discharge, reaching 0 volt, and then went into voltage reversal. After 2.5 hours of forced overdischarging, there was a venting (indicated by a "pop") accompanied by the tail piece cracking almost its entire length around the area where the potting was previously cracked. Three minutes later another venting occurred (also indicated by a "pop"). When the ventings occurred there was a noticeable smell, similar to the odor of ether. This probe was dissected. From

the arrangement of the cell, the battery, and the position of the crack it was not possible to say if thermal expansions, venting, or internal heat from either the PX28L or the DL<sub>3</sub>N caused the cracking. Testing performed on probe 5 (serial no. 13977) was similar to that of probe 4. The results were the same. About 2.5 hours into voltage reversal a venting occurred. The highest temperature seen for either probe was 51°C at the time of venting. Dissection of probe 5 revealed that thermal expansions in the DL<sub>3</sub>N and the proximity of this cell to the edge of the potting was the most probable cause of the cracking. Figure 14 is a representative graph for discharging an SSXSV battery (potted in a probe) into voltage reversal.

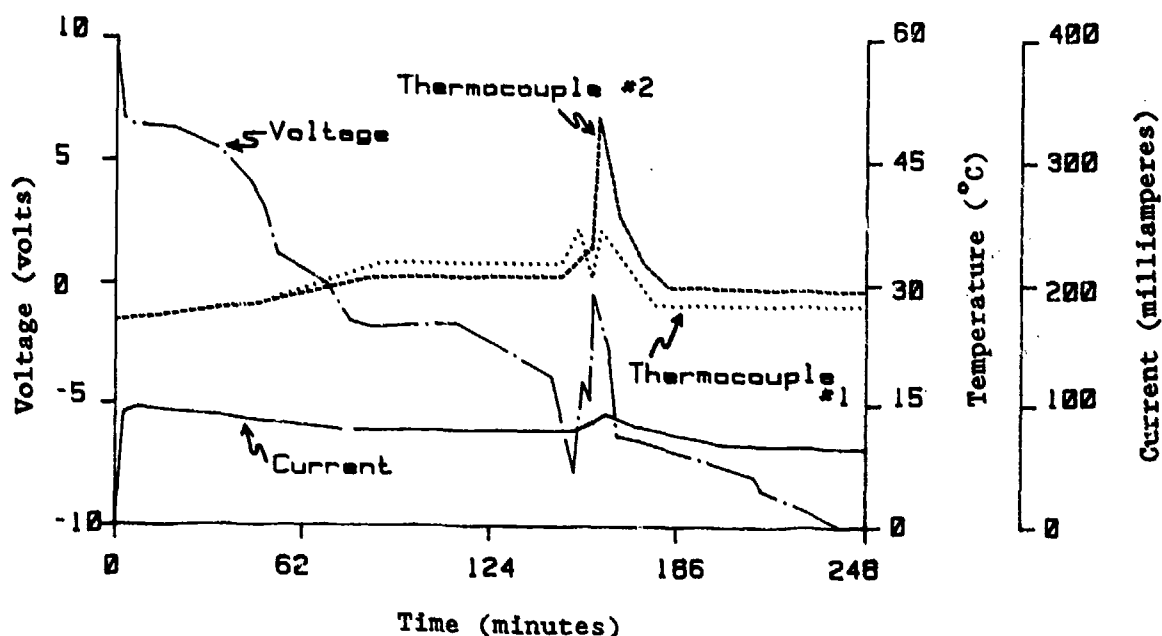


FIGURE 14. FORCED OVERDISCHARGE OF AN SSXSV BATTERY (POTTED IN A PROBE) AT THE C/2 RATE

Probe 6 (serial no. 13978) and probe 7 (serial no. 13979) were discharged into voltage reversal within the SSXSV canisters. The canister of probe 6 was pressure tested by filling it with oxygen ( $O_2$ ) to 8 psi. After confirming that the canister was indeed a sealed environment, it was fitted with a gas collection vessel. About 2.5 hours into the discharge (the battery was into reversal at this time) venting occurred with a flame exiting the tube around the o-ring seal. However, this test was judged to be invalid as a test of canister durability. Apparently, a greater amount of  $O_2$  than normal was trapped inside the canister, causing this reaction. If this were true, the gas sample collected from this canister would be expected to contain more  $O_2$  than a sample collected from a canister in which the battery vented under normal conditions. Indeed, mass spectrometric analysis of off-gas products, performed by the National Bureau of Standards (project no. 5533462), revealed that this was the case. Probe 7 was also tested in the same manner as probe 6, with the exception that  $O_2$  was not used to check canister sealing integrity. Probe 7 did not vent during discharge into voltage reversal at the 80mA rate, so 1 ampere (A) was driven through the battery by 100V which caused a mild venting. This allowed a gas sample to be collected. The off-gas products of probe 7 were also analyzed. From Figure 15 it can be

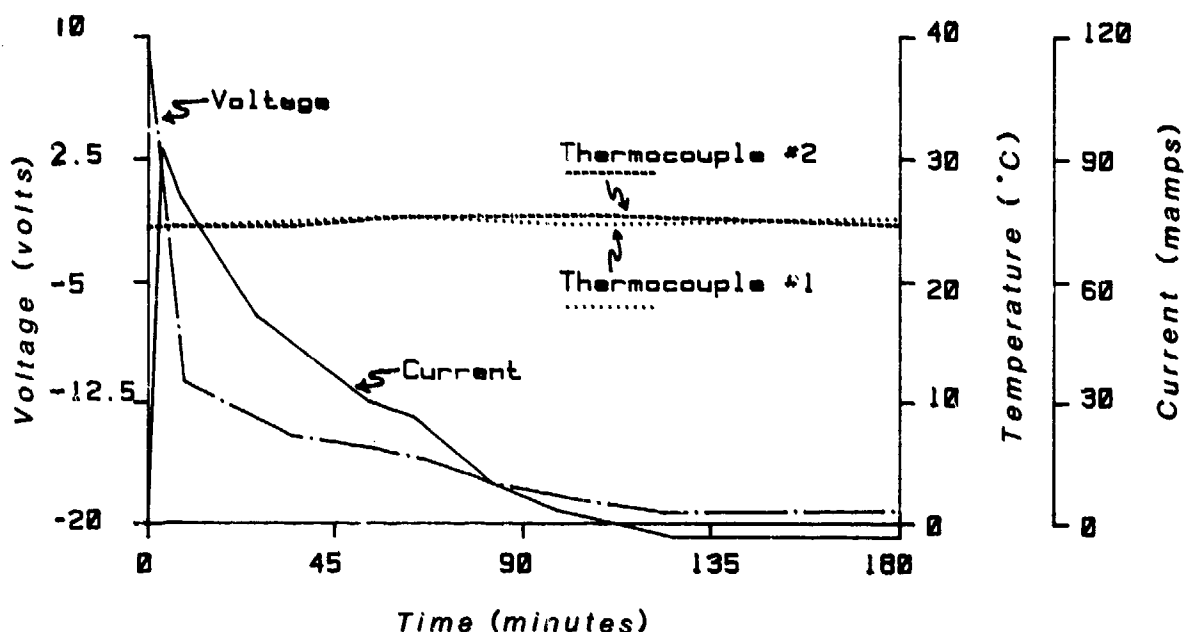


FIGURE 15. RESULTS OF FORCE OVERDISCHARGING AN SSXSV BATTERY (POTTED IN PROBE 7) AT THE C/2 RATE

seen that the voltage and current monitored on probe 7 dropped very rapidly unlike other discharges into voltage reversal. The temperatures monitored on probes 6 and 7 were on the outside of the canister which explains their ambient readings throughout testing.

Table 1 lists the contents of each gas collection vessel sent to the National Bureau of Standards. The report received from the Bureau indicated that no harmful or toxic gases were detected. Hydrogen gas ( $H_2$ ) was detected in small quantities and therefore the possibility of a minor explosion exists. This could occur if the probes were exposed to temperatures exceeding roughly  $200^\circ C$ .

TABLE 1. ANALYSIS OF THE OFF-GAS PRODUCTS OF TWO  $Li/MnO_2$  BATTERIES

Component	Composition, mole percent	
	Serial # 13978	Serial # 13979
$H_2$	4.1	11
$CH_4$	0.5	6.8
$N_2$	58	53
$O_2$	23	13
Ar	0.6	0.8
$CO_2$	13	7.8
CO	---	6.8
*HC	0.2	1.6

\*Consists of one or more hydrocarbon constituents.

## CHAPTER 4

## CONCLUSIONS

The Duracell Li/MnO<sub>2</sub>, DL<sub>3</sub>N cell and PX28L battery behaved well under abusive testing conditions characteristic of NAVSEA Notice 9310. The SSXSV battery made of one DL<sub>3</sub>N and one PX28L connected in series was found to be safe for use in the SSXSV probe. The probe configuration in which the DL<sub>3</sub>N and PX28L are completely potted does not allow for thermal expansion. Therefore, probes subjected to abusive conditions can be expected to crack. However, cracking does not lead to a safety problem. Using three DL<sub>3</sub>N cells connected in series with space for expansions or packing the cells in soft potting, would possibly improve probe durability. Mass spectrometric analysis of off-gas products (produced by battery abuse) did not detect harmful amounts of toxic gases. Small amounts of H<sub>2</sub> found in the venting products indicates the need to protect canister units from temperatures in excess of 200°C. However, the canister construction is durable enough to contain ventings of the SSXSV battery. Because of the ability of the canister to totally contain battery ventings, the SSXSV system is acceptable for internal carriage on a submarine.

## DISTRIBUTION

<u>Copies</u>	<u>Copies</u>
Commander	Commander
Naval Sea Systems Command	Naval Weapons Center
Attn: Sea 63R3 1	Attn: Code 38 (E. Royce) 1
Sea 63X3 (J. Lascody) 1	Code 3852 1
Sea 9823 1	Code 3626 (W. Haight) 1
Sea 65321 (H. Holter) 2	China Lake, CA 93555
Sea 09G32 2	
Sea 921AN 1	Office of Naval Research
Sea 543 1	Attn: ONR 472 (G. Neece) 2
Washington, DC 20362	800 N. Quincy Street
	Arlington, VA 22217
Commander	Commander
Naval Ocean Systems Center	Naval Intelligence Support Center
Attn: Code 19 (CAPT M. Dorman) 1	Attn: Code 362 1
Code 922 1	Washington, DC 20390
Code 712 (J. McCartney) 1	
San Diego, CA 92152	Office of Navy Technology
Commander	Associate Director
Naval Weapons Support Center	Attn: Support Technology (072) 1
Electrical Power Sources Division	800 N. Quincy Street
Attn: Code 3054 (S. Shuler) 1	Arlington, VA 22217
Crane, IN 47522-5030	
Commander	Chief of Naval Operations
Space and Naval Warfare Systems	Operating Evaluation Group 1
Command	Washington, DC 20350
Attn: Code PME124-31 (A. Sobel) 1	
Code PME 106-13B 1	Commander
(W. McCabe) 1	Naval Air Development Center
SPAWAR 01K (A. Sliwa) 1	Attn: Library 1
40736 (W. Weingartner) 1	Warminster, PA 18974
Washington, DC 20363-5100	
Commander	Defense Technical Information
Naval Underwater Systems Center	Center
Attn: Code 8191 (R. Lazar) 2	Cameron Station 12
Code 8125 (J. Moden) 1	Alexandria, VA 22304-6145
Newport, RI 02840	
	Library of Congress
	Attn: Gift and Exchange Division 4
	Washington, DC 20540

## DISTRIBUTION (Cont.)

	<u>Copies</u>		<u>Copies</u>
Jet Propulsion Laboratory Attn: MS 277-102 (G. Halpert) 4800 Oak Grove Drive Pasadena, CA 911909	2	Mare Island Naval Ship Yard Attn: Code 280.08 Stop 060 (R. Houlder) Vallejo, CA 94592	1
Saft America Inc. Advanced Battery Systems Attn: Franklin C. Regan 107 Beaver Court Cockeysville, MD 21030	1	David W. Taylor Naval Ship and Development Center Annapolis Laboratory Attn: Code 2724 (H. R. Urbach) Code 2724 (R. Bloomquist) Annapolis, MD 21401	1 1
U. S. Army Laboratory Command Attn: Code SLET-PB (T. Reiss) Code SLCET-PR (S. Gilman) Fort Monmouth, NJ 07703	1 1	NOAA Data Buoy Center Attn: D. Scully NSTL Station, MS 39529	1
Air Force Aero Propulsion Laboratory Attn: AFWAL/POOC-1 (W. S. Bishop) AFAPL/OPF-1 (D. Marsh) Wright Patterson AFB, OH 45433	1 1	U. S. Army HQDA-DAEN-ASR-SL Washington, DC 20314	1
NASA Johnson Space Center Attn: Code EP5 (B. J. Bragg) NASA Road 1 Houston, TX 77058	1	Norton Air Force Base Attn: Code BMO/ENBE Code AFISC/SES Norton AFB, CA 92409	1 1
National Bureau of Standards Attn: William Dorko B 364 (CHEM) Washington, DC 20234	1	NASA Goddard Space Flight Center Attn: Code 711 Greenbelt, MD 20771	1
Panasonic Industrial Company Attn: R. Morioka P. O. Box 1511 Secaucus, NJ 07094	1	NASA Langley Attn: MS 433 (J. Cowdey) Hampton, VA 23665	1
Wilson Greatbatch Ltd. Attn: P. Krehl 10000 Wehrle Drive Clarence, NY 14031	1	Central Intelligence Agency C/O OTS Attn: Tyler X. Mahy Washington, DC 20505	1
EIC Corporation Attn: K. M. Abraham 111 Downey Street Norwood, MA 02062	1	Headquarters Department of Transportation U. S. Coast Guard Ocean Engineering Division Attn: GEOE-3/61 (R. Potter) Washington, DC 20590	1



## DISTRIBUTION (Cont.)

	<u>Copies</u>		<u>Copies</u>
Magnavox Department 529 Attn: Carl Keuneke 1313 Production Road Fort Wayne, IN 46808	1	Power Conversion Incorporated 495 Boulevard Elmwood Park, NJ 07407	1
Gould Incorporated Gould Laboratories 40 Gould Center Rolling Meadows, IL 60000	1	Lockheed Palo Alto Research Laboratory Lockheed Missiles and Space Company Incorporated Attn: Library 3251 Hanover Street Palo Alto, CA 94304	1
The Aerospace Corporation Attn: H. F. Bittner MS/275 P. O. Box 92957 Los Angeles, CA 90009	1	General Electric Company Attn: R. W. Race Manager Advance Programs Marketing Room 2544A-OP#2 100 Plastics Avenue Pittsfield, MA 012001	1
Honeywell Incorporated Power Sources Center Attn: Library D. Chua 104 Rock Road Horsham, PA 19044	1	Battery Engineering, Inc. Attn: N. Marincic 1636 Hyde Park Rd. Hyde Park, MA 02136	1
The Boeing Company Attn: A. C. Johnson P. O. Box 3707 Seattle, WA 98124	1	GTE Sylvania Attn: R. McDonald 189 B Street Needham Heights, MA 02194	1
GTE Laboratories Incorporated Attn: Library 40 Sylvan Road Waltham, MA 02154	1	Altus Corporation 1610 Crane Court San Jose, CA 95112	1
Teledyne Electronics Attn: G. Lamb 649 Lawrence Drive Newbury Park, CA 91320	1	Yardney Electric Corporation Attn: Library 82 Mechanic Street Pawcatuck, CT 02891	1
Duracell U. S. A. Attn: Glenn Cruze Keith Mauter Technical Sales Marketing Group Berkshire Industrial Park Bethel, CT 06801	1	Eagle-Picher Industries Couples Department Attn: Library Joplin, MO 64801	1
		Advanced Battery Group Attn: R. Murphy 269 Westwood Street Lancaster, NY 14086	1

## DISTRIBUTION (Cont.)

	<u>Copies</u>		<u>Copies</u>
Ray-O-Vac		Internal Distribution:	
Attn: R. F. Udell	1	R30	1
B. C. Bergum	1	R33 (Files)	1
101 East Washington Street		R33 (Staff)	20
Madison, WI 53703		R33 (Barnes)	70
		E35	1
Navy Environmental Health Center		E231	2
Attn: J. R. Crawl, Head	1	E232	15
Hazardous Material		E342 (GIDEP)	1
Evaluation Branch			
Naval Station			
Norfolk, VA 23511			
Sparton Electronics			
Attn: C. H. Bush	1		
2400 East Ganson Street			
Jackson, MI 49202			
Sanders Associates			
Attn: G. Disco	1		
95 Canal Street			
Nashua, NH 03061			
Sonatech Incorporated			
Attn: R. Cyr	1		
879 Ward Drive			
Santa Barbara, CA 93111-2920			
Dr. Howard E. Ruskie	1		
Naval Liaison Unit-Munich			
APO			
New York, NY 09108			
Sandia National Laboratories			
Attn: S. C. Levy, Division 2523	1		
P. O. Box 5800			
Albuquerque, NM 87185			
ATR			
Attn: Dr. J. Parry	1		
3933 Sandy Spring Rd.			
Burtonsville, MD 20864			
DME Corporation			
Attn: J. Ciesla	1		
111 S.W. 33rd Street			
Ft. Lauderdale, FL 33315			